Home Report

One triangle, all angles covered

RESIDENTIAL / COMMERCIAL / PROPERTY & CONSTRUCTION

www.shepherd.co.uk





- 1. Single Survey
- 2. Energy Performance Certificate
- 3. Property Questionnaire





Scottish Single Survey



survey report on:

Property address	Temple Croft Kirkcudbright DG6 4SA
------------------	--

Customer	Mr A Goodwin

Customer address	Temple Croft Kirkcudbright DG6 4SA
------------------	--

Prepared by	Shepherd Chartered Surveyors
-------------	------------------------------

Date of inspection	06/11/2023



www.shepherd.co.uk

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by marking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

Х

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report².

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;

- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments

being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 <u>Category 2:</u> Repairs or replacement requiring future attention, but estimates are still advised.
- 3 <u>Category 1:</u> No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein

the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

• There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use

communal grounds, parking areas, and other facilities;

- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	Detached two storey villa.
Accommodation	Ground Floor:
	Lounge, Dining Room, Kitchen/Dining Room, Utility Room, Study and Cloakroom with w.c.
	First Floor:
	4 Bedrooms, en-suite Bathroom with w.c. and Bathroom with w.c.

Gross internal floor area (m²)	222m ² or thereby.
Neighbourhood and location	The property is situated in a private residential district on the outskirts of the town of Kirkcudbright where adequate public transport, shopping, social and educational facilities can be
	found.

Age	The property is understood to have been constructed around 1927.
Weather	Overcast but dry.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate.
	The chimney heads are of brick construction externally roughcast with lead flashings.

Desting including reaf analo	Claning reafe were viewally increased with the sid of
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.
	Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.
	Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.
	If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.
	The roof is pitched and laid in slates with stone ridging. There is a small section of flat concrete roofing over the lounge bay window.
	Access to the roof void is via a hatch in the first floor hallway ceiling. This area is partially floored and has basic insulation. It has a loft ladder and a light fitted. Our inspection was restricted to the floored area only.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	The gutters and downpipes are a mix of PVC & cast iron.
Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The main walls are of cavity brick construction, externally rendered, extended in cavity concrete block externally rendered. It is understood that cavity wall insulation has been installed.

Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	The main entrance door is timber and glazed with a UPVC double glazed rear door.
	The windows are UPVC sealed unit double glazed of casement design with two timber casement single glazed windows in the dining room.

External decorations	Visually inspected.

Conservatories / porches	None.
--------------------------	-------

Communal areas	None.
Garages and permanent outbuildings	Visually inspected.

There is a double garage, extending to 52m² or thereby, of concrete block construction externally roughcast with a slated roof. There are electric doors and the benefit of power and lighting. Attached to the garage is a small concrete block, roughcast and slated store. Attached to the side of the main building is a brick and roughcast/slate workshop, extending to 14m² or thereby, which has the benefit of power and lighting.

Outside areas and boundaries	Visually inspected.	
	There are garden grounds on all sides of the property bounded by stone walling, hedging, brick and rendered walling and post and wire fencing.	

Ceilings	Visually inspected from floor level.	
	The ceilings appear to be mainly of timber lath and plaster with some timber beam features.	

Internal walls	Visually inspected from floor level.	
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.	
	The internal walls are mainly of plaster on the hard with some timber panelling.	

Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.	
	Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.	
	Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.	
	The floors are of suspended timber construction, part concrete. The property was fully furnished and the floors were covered throughout and accordingly there was no view possible of the floor timbers/surfaces. We were unable to locate an access hatch to any sub-floor areas which may exist.	

Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.	
	Kitchen units were visually inspected excluding appliances.	
	The internal doors are timber panelled. The kitchen has modern wall and base storage units. A timber carpeted staircase leads to first floor level.	

Chimney breasts and fireplaces	Visually inspected.	
	No testing of the flues or fittings was carried out.	
	The lounge has a solid fuel stove with a brick surround. The dining room has a solid fuel fireplace with a brick surround. All other fireplaces have been blocked off with the surrounds removed.	

Internal decorations	Visually inspected.
Cellars	None.

Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.	
	There is a mains supply of electricity. The electric meter and consumer unit are in the utility room cupboard.	

Gas	None.	
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.	
	No tests whatsoever were carried out to the system or appliances.	
	There is a mains supply of water. The kitchen has a stainless steel sink unit. The utility room has twin white wash tubs. The bathroom has a modern three piece white suite and a shower cubicle. The cloakroom has a modern white w.c. and wash hand basin. The en-suite bathroom has a modern three piece white suite with a shower fitted over the bath. In the roof void there is a plastic cold water storage tank which is insulated.	
Heating and hot water	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.	
	No tests whatsoever were carried out to the system or appliances.	
	Space heating is by means of an oil fired central heating system with radiators located in the main apartments. The system is operated by means of a free-standing 'Worcester' central heating boiler, in the utility room cupboard, having a fanned flue. It is understood to have been installed in 2018. There is a plastic oil storage tank beside the garage.	
	Hot water is heated by means of an electric immersion heater and the central heating system. There is a thermal store in the utility room cupboard.	

Drainage	Drainage covers etc. were not lifted.	
	Neither drains nor drainage systems were tested.	
	Drainage is understood to be connected to a septic tank in the front garden.	
Fire, smoke and burglar alarms	Visually inspected.	
	No tests whatsoever were carried out to the system or appliances.	
	All Scottish homes require a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon- fuelled appliance such as a boiler, open fire or wood burner, a carbon monoxide detector is also required. We have not assessed or tested any existing equipment and it is the purchasers responsibility to confirm that the property will comply with these standards following a change of ownership.	
	No comment is made on the existence or otherwise of a burglar alarm.	
Any additional limits to inspection	An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor.	



2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1

Structural movement	
Repair category	1
Notes	There was no evidence of significant structural movement within the limitations of our inspection.

Dampness, rot and infestation	
Repair category	2
Notes	There is isolated dampness in the walls above the dining room window and in the lounge bay walls.
	Woodworm in the roof timbers is understood to be have been treated by a firm of timber specialists.

Chimney stacks	
Repair category	1
Notes	Chimney stacks appear to be in a fair state of repair within the limitations of our inspection but can be vulnerable to defect and should be regularly maintained.

Roofing including roof space	
Repair category	2
Notes	There is no underslate felt in the roof structure indicating that the roof coverings are likely to be original. There is a slipped slate and there is moss growth on the roof at the rear. Roof coverings are of an age and style where a degree of regular ongoing maintenance should be anticipated. More extensive overhaul/renewal work may be required in future. Woodworm in the roof timbers is understood to have been treated by a firm
	Woodworm in the roof timbers is understood to have been treated by a firm of timber specialists. The documentation is assumed to be in order.

Rainwater fittings	
Repair category	1
Notes	We would highlight that it was not raining at the time of our inspection and we would recommend that all rainwater fittings be inspected during heavy rainfall in order to ensure they are free from defect.

Main walls	
Repair category	1
Notes	Within the limitations of our inspection, no significant defects were noted, however normal levels of maintenance are recommended.

Windows, external doors and joinery	
Repair category	1
Notes	Windows were not all fully opened or tested, and it should be appreciated that some defects are only evident during certain weather conditions. Within the limitations of our inspection, no significant defects were noted.

External decorations	
Repair category	1
Notes	Paint finished and decorated external surfaces will require redecoration on a regular basis.

Conservatories/porches	
Repair category	N/A
Notes	Not applicable.

Communal areas	
Repair category	N/A
Notes	Not applicable.

Garages and permanent outbuildings	
Repair category	1
Notes	There is dampness in the walls of the workshop.

Outside areas and boundaries	
Repair category	2
Notes	There is cracking and movement to the boundary walls. Some of the fencing requires attention. There are large trees within the gardens which are likely to require ongoing maintenance.

Ceilings	
Repair category	1
Notes	There is some cracked and damaged plasterwork.

Internal walls	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Floors including sub-floors	
Repair category	1
Notes	Due to fitted carpets and floor coverings no detailed inspection of floors was possible and accordingly no comment can be made on their condition.

Internal joinery and kitchen fittings	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Chimney breasts and fireplaces	
Repair category	1
Notes	A number of the fire places have been removed/covered over. It is assumed that the chimneys are adequately vented with the chimneys capped. Ventilators should be fitted to prevent the build-up of dampness within the chimney flue.

Internal decorations	
Repair category	1
Notes	The property is in good decorative order.

Cellars	
Repair category	N/A
Notes	Not applicable.

Electricity	
Repair category	1
Notes	The Institution of Engineering Technology recommends that inspections and testings are undertaken at least every five years and on a change of occupancy. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IET regulations.

Gas	
Repair category	N/A
Notes	Not applicable.

Water, plumbing and bathroom fittings	
Repair category	1
Notes	No tests have been undertaken of the system, however within the limitations of our inspection, no significant defects were noted. No inspection has been possible to enclosed timbers beneath wet appliances and no comment has been made on the condition of unseen areas. Watertight seals will require to be regularly checked and replaced, to prevent water damage to adjoining areas.

Heating and hot water	
Repair category	1
Notes	It is assumed that the central heating system has been properly installed, updated and maintained to meet with all current regulations and standards with particular regard to fluing and ventilation requirements. Service records should be obtained and checked. In the absence of service documentation further advice should be obtained from a qualified heating engineer to ascertain the condition, efficiency, and life expectancy of the system.

Drainage	
Repair category	1
Notes	There are understood to be private drainage arrangements in the form of a septic tank. The maintenance liability, rights of access and SEPA consents should be confirmed.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	1
Roofing including roof space	2
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	N/A
Communal areas	N/A
Garages and permanent outbuildings	1
Outside areas and boundaries	2
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	N/A
Electricity	1
Gas	N/A
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Wherea lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Grou	nd and	d First F	loor
2. Are there three steps or fewer to a main entrance door of the property?	Yes	X	No	
3. Is there a lift to the main entrance door of the property?	Yes		No	X
4. Are all door openings greater than 750mm?	Yes		No	X
5. Is there a toilet on the same level as the living room and kitchen?	Yes	X	No	
6. Is there a toilet on the same level as a bedroom?	Yes	X	No	
7. Are all rooms on the same level with no internal steps or stairs?	Yes		No	X
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes	X	No	

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The assumed tenure is Absolute Ownership.

Access to the property is via a rough shared driveway leading from a public road. It is assumed that there is a liability for an equitable share in the upkeep.

The property has a septic tank drainage system for which we assume all relevant permissions are in order.

There have been alterations to the property in the form of the removal of a chimney and the construction of a double garage. It is assumed that the relevant Planning/Building Warrant documentation is in order.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £750,000.

This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

Valuation and market comments

Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £780,000 (SEVEN HUNDRED AND EIGHTY THOUSAND POUNDS STERLING).

Signed	<i>J Malcolm Hunter</i> Electronically signed :- 10/11/2023 09:35
Report author	J Malcolm Hunter

Company name	J & E Shepherd Chartered Surveyors
Address	18 Castle Street Dumfries DG1 1DR
Date of report	06/11/2023



www.shepherd.co.uk

Property Address	
Address Seller's Name Date of Inspection	Temple Croft, Kirkcudbright, DG6 4SA Mr A Goodwin 06/11/2023
Property Details	
Property Type X House Purpose built fla	Bungalow Purpose built maisonette Converted maisonette t Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks)
Property Style X Detached Back to back	Semi detached Mid terrace End terrace High rise block Low rise block Other (specify in General Remarks)
Does the surveyor believe that th military, police? Flats/Maisonettes only Floor(s) on Approximate Year of Constructio	No. of units in block
Tenure	
X Absolute Ownership	Other
Accommodation	
Number of Rooms 3 Living room 2 Bathroom	
Gross Floor Area (excluding gara Residential Element (greater than	
Garage / Parking / Outbuilding	S
Single garage X Double	garage Parking space No garage / garage space / parking space
Available on site? X Yes	No
Permanent outbuildings:	
Brick and slated workshop and store.	

Construction
Walls X Brick Stone Concrete Timber frame Other (specify in General Remarks)
Roof Tile X Slate Asphalt Felt Other (specify in General Remarks)
Special Risks
Has the property suffered structural movement?
If Yes, is this recent or progressive?
Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in 🗌 Yes 🗵 No the immediate vicinity?
If Yes to any of the above, provide details in General Remarks.
Service Connections
Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks
Drainage Mains X Private None Water X Mains Private None Electricity X Mains Private None Gas Mains Private X None
Central Heating X Yes Partial None
Brief description of Central Heating and any non mains services:
Oil fired boiler to radiators.
Site Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.
Rights of way X Shared drives / access Garage or other amenities on separate site Shared service connections
Ill-defined boundaries Agricultural land included with property Other (specify in General Remarks)
Location
Residential suburb X Residential within town / city Mixed residential / commercial Shared service connections
Commuter village Remote village Isolated rural property Other (specify in General Remarks)
Planning Issues
Has the property been extended / converted / altered? X Yes No
If Yes provide details in General Remarks.
Roads
Made up road Unmade road Partly completed new road Pedestrian access only X Adopted Unadopted

General Remarks

The property has been generally well maintained having due regard to its age and nature with fittings on modern lines and the decoration to a good standard. No significant defects were noted which in our opinion would affect value. Woodworm within the property is understood to have been treated by a firm of timber specialists and it is assumed that the relevant documentation is in order. The roof coverings appear to be mainly original and ongoing maintenance is likely to be required.

In addition to the main accommodation there is a utility room.

Access to the property is via a rough shared driveway leading from a public road. It is assumed that there is a liability for an equitable share in the upkeep.

The property has a septic tank drainage system for which we assume all relevant permissions are in order.

There have been alterations to the property in the form of the removal of a chimney and the construction of a double garage. It is assumed that the relevant Planning/Building Warrant documentation is in order.

Essential Repairs

None.		
Estimated cost of essential repairs	N/A	
Retention recommended?	Yes X No	
Retention recommended ?		
Retention amount	N/A	

Comment on Mortgageability

The property forms suitable security for mortgage purposes subject to the specific lending criteria of any mortgage provider.

Valuation		
Market value in present condition	£	780,000
Market value on completion of essential repairs	£	
Insurance reinstatement value	£	750,000
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)		
Is a reinspection necessary?		Yes X No

Declaration

Signed	
Surveyor's name	<i>,</i>

Company name

Email Address

Date of Inspection

Address

Telephone

Professional qualifications

J Malcolm Hunter Electronically signed :- 10/11/2023 09:35 J Malcolm Hunter MRICS J & E Shepherd Chartered Surveyors 18 Castle Street, Dumfries, DG1 1DR 01387 264333 dumfries@shepherd.co.uk 06/11/2023



Energy Performance Certificate



Energy Performance Certificate (EPC)

Scotland

Dwellings

TEMPLE CROFT, BORGUE, KIRKCUDBRIGHT, DG6 4SA

Dwelling type:	Detached house
Date of assessment:	06 November 2023
Date of certificate:	08 November 2023
Total floor area:	222 m ²
Primary Energy Indicator:	177 kWh/m ² /year

Reference number: Type of assessment: Approved Organisation: Main heating and fuel:


4490-3762-0822-7009-1973 RdSAP, existing dwelling Elmhurst Boiler and radiators, oil

You can use this document to:


- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£8,604	See your recommendations
Over 3 years you could save*	£1,209	report for more information

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

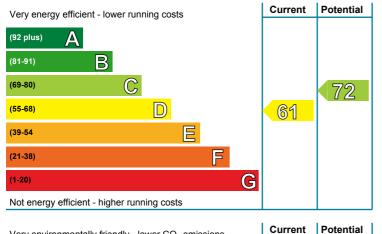

Very environmentally friendly - lower CO₂ emissions

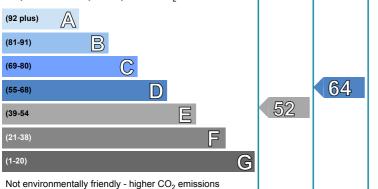

Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is band D (61). The average rating for EPCs in Scotland is band D (61).

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (52)**. The average rating for EPCs in Scotland is band D (59).

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Flat roof or sloping ceiling insulation	£850 - £1,500	£312.00
2 Floor insulation (solid floor)	£4,000 - £6,000	£648.00
3 Solar water heating	£4,000 - £6,000	£249.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE **DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, filled cavity	★★★☆☆	★★★☆☆
Roof	Pitched, 200 mm loft insulation Pitched, no insulation (assumed)	★★★★☆ ★☆☆☆☆	★★★★☆ ★☆☆☆☆
Floor	Solid, no insulation (assumed)	—	_
Windows	Fully double glazed	★★★★☆	★★★★☆
Main heating	Boiler and radiators, oil	★★★ ☆☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	Room heaters, dual fuel (mineral and wood)	—	—
Hot water	From main system	★★★ ☆☆	★★★☆☆
Lighting	Low energy lighting in 96% of fixed outlets	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 46 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 10 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.4 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

TEMPLE CROFT, BORGUE, KIRKCUDBRIGHT, DG6 4SA 08 November 2023 RRN: 4490-3762-0822-7009-1973

Estimated energy c	osts for this home		
	Current energy costs	Potential energy costs	Potential future savings
Heating	£7,113 over 3 years	£6,180 over 3 years	
Hot water	£750 over 3 years	£474 over 3 years	You could
Lighting	£741 over 3 years	£741 over 3 years	save £1,209
Totals	£8,604	£7,395	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

De		Indicative cost	Typical saving	Rating after	improvement
Re	commended measures	indicative cost	per year	Energy	Environment
1	Flat roof or sloping ceiling insulation	£850 - £1,500	£104	D 62	E 54
2	Floor insulation (solid floor)	£4,000 - £6,000	£216	D 66	D 57
3	Solar water heating	£4,000 - £6,000	£83	D 67	D 59
4	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£655	C 72	D 64

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

energ saving

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Flat roof or sloping ceiling insulation

Insulating a flat roof or sloping ceiling will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation can be placed on top of the roof under the waterproof membrane and should particularly be considered when the waterproofing needs to be replaced. Further information about roof insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

2 Floor insulation (solid floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulating solid floors can present challenges; insulation laid on top of existing solid floors may impact on existing doors and finishes whilst lifting of a solid floor to insert insulation below will require consideration of the potential effect on both structural stability and damp proofing. It is advised to seek advice from a Chartered Structural Engineer or a registered Architect about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work and may also require a building warrant so it is best to check with your local authority building standards department.

3 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

4 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	26,307	N/A	N/A	N/A
Water heating (kWh per year)	3,015			

TEMPLE CROFT, BORGUE, KIRKCUDBRIGHT, DG6 4SA 08 November 2023 RRN: 4490-3762-0822-7009-1973

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Assessor membership number: Company name/trading name:	Mr. James Hunter EES/016139 J & E Shepherd
Address:	18 Castle Street
	Dumfries
	DG1 1DR
Phone number:	01387 264333
Email address: Related party disclosure:	dumfries@shepherd.co.uk No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.









Property address	Temple Croft Kirkcudbright DG6 4SA
Seller(s)	Mr A Goodwin
Completion date of property questionnaire	01/11/2023

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership		
	How long have you owned the proper	ty?	5 years
2.	Council tax		
	Which Council Tax band is your prope	erty in?	G
3.	Parking		
	What are the arrangements for parkin (Please tick all that apply)		
	Garage	Yes	
	 Allocated parking space 	Νο	
	• Driveway	Yes	
	 Shared parking 	Νο	
	On street	No	
	Resident permit	No	
	Metered Parking	No	
	 Other (please specify): 		
4.	Conservation area		
	Is your property in a designated Cons special architectural or historical inte which it is desirable to preserve or er	rest, the character or appea	

Listed buildings	
Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	No
Alterations/additions/extensions	
(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	Yes
<u>If you have answered yes,</u> please describe below the changes which you have made:	
Complete restoration: > Double Garage build 9mx7m, 2xfully electric Horman doors, double brick and insulated.	
> Includes alteration to old garage - remove chimney and fire place between old garage and study. Removal of flat roof extension to old garage. Make good, doors, ceolin and widows to old garage; now a workshop. This plan includes to heighten and slate the roof of existing coal and oil store adjoining the new garage location. Plans and building certificate available for this work.	
Further renovation included: > Roof repairs to front apex, various slate replacements, leadwork round chimney bases > Replacement guttering, repair to cast bolts > Complete replacement of double glazing and internal wood finishing surrounds > New external door to rear of property, to store and renovation of front door > Existing x 2 house chimneys replacement of crown cap x 2. New pots. Removal of fire places, vents replaced. > Addition of Clearview stove in lounge, liner and finishing's to brick fireplace > Complete new plumbing & heating. All new radiators, pipe work > New boiler, 300ltr tank, new Worcester oil boiler fully serviced. Run by new Drayton Dual online technology system for heating and hot water. > All radiators are new, 3 convection, 16 Apollo + towel rail > Bathrooms x 2, Cloakroom and utility; all plumbing, vanity ware, fixtures & pipework > All flooring new, in Kitchen, utility, under stair and pantry, levelled and tiled > All new kitchen, and appliances, with 3 x ovens > Security lighting outside > Various plastering > New lighting, sockets > New main electrics, fuse box and smart meter > Fire alarms, heat detectors > New curtain poles, ornate finials Plus blinds, decoration Outside: > Replacement fences, gates and shed/wood store > Tree felling, planting and landscaping > Replacement inspection chamber to sceptic tank & inspected	
 Replacement inspection chamber to sceptic tank & inspected 12 x 8 greenhouse 2500 double skinned oil tank and remote monitoring. 	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)? Alterations/additions/extensions (i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? If you have answered yes, please describe below the changes which you have made: Complete restoration: > Double Garage build 9mx7m, 2xfully electric Horman doors, double brick and insulated. > Includes alteration to old garage - remove chimney and fire place between old garage and study. Removal of flat roof extension to old garage. Make good, doors, ceolin and widows to old garage; now a workshop. This plan includes to heighten and slate the roof of existing coal and oil store adjoining the new garage location. Plans and building certificate available for this work. Further renovation included: > Roof repairs to front apex, various slate replacements, leadwork round chimney bases > Replacement guttering, repair to cast bolts > Complete replaces, vents replaced. > Addition of Clearview stove in lounge, liner and finishing's to brick fireplace > Complete new plumbing & heating. All new radiators, pipe work > New boiler, 300tir tank, new Worcester oil boiler fully serviced. Run by new Drayton Dual online technology system for heating and hot water. > All radiators are new, 3 convection, 16 Apollo + towel rail > Bathrooms x 2, Cloakroom and utility; all plumbing, vanity ware, fixtures & pipework > All flooring new, in Kitchen, utility, under stair and pantry, levelled and tiled > All new tichen, and appliances, with 3 x ovens > Security lighting outside > Various plastering > New wighting, sockets > New wain electrics, fuse box and smart meter > Fire alarms, heat detectors > New curtain poles, ornate finials Plus blinds, decoration Outside: > Replacement fences, gates and shed/wood store > Tree felling, planting and landscaping > Replaceme

	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	Yes
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
э.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?	Yes
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes
	(ii) Did this work involve any changes to the window or door openings?	No
	(iii) Please describe the changes made to the windows doors, or patio doors approximate dates when the work was completed):	(with
	Please give any guarantees which you received for this work to your solicito agent.	r or estate
	Work was progressive with most being replaced in 2018 to 2019. Some later on in the project up to 2023, as renovation moved along. Love and attention to detail, all in keeping with period circa 1927 build. We prefer the word restored rather than renovated.	
7.	Central heating	
a.	In these second and the attinum association in second process where a start of	Yes
	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).	res
	(Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the	res
	(Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom). <u>If you have answered yes or partial</u> – what kind of central heating is there?	res
	 (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom). <u>If you have answered yes or partial</u> – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). 	res
	 (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom). <u>If you have answered yes or partial</u> – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). Oils fired water open system. 	
	 (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom). <u>If you have answered yes or partial</u> – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). Oils fired water open system. <u>If you have answered yes</u>, please answer the three questions below: i) When was your central heating system or partial central heating system 	
	 (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom). <u>If you have answered yes or partial</u> – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). Oils fired water open system. <u>If you have answered yes</u>, please answer the three questions below: i) When was your central heating system or partial central heating system installed? 	No

	(Please provide the month an	id year).		
•	Energy Performance Certificate			
	Does your property have an I than 10 years old?	Energy Performance (Certificate which is less	No
•	Issues that may have affected your property			
	Has there been any storm, flo property while you have own		ctural damage to the	No
	If you have answered yes, is insurance claim?	the damage the subje	ect of any outstanding	
-	Are you aware of the existen	ce of asbestos in you	r property?	No
	If you have answered yes, please give details:			
0.	Services			
	Please tick which services ar supplier:	e connected to your p	property and give details o	of the
	Services	Connected	Supplier	
	Gas or liquid petroleum gas	No		
	Water mains or private water supply	Yes	Scottish Water	
	Electricity	Yes	Scottish Power	
_	Mains drainage	No		
_	Telephone	Yes	BT	
	Cable TV or satellite	No		
	Broadband	Yes	ВТ	
•	Is there a septic tank system	at your property?		Yes
	If you have answered yes, please answer the two questions below:			
	(i) Do you have appropriate c tank?	onsents for the disch	arge from your septic	Yes
F	(ii) Do you have a maintenand	a contract for your a	antia tambo	No

	If have answered yes, details of the company with which you have a maintenance contract:	
11.	Responsibilities for shared or common areas	1
а.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?	No
	If you have answered yes, please give details:	
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?	No
	If you have answered yes, please give details:	
с.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	No
d.	Do you have the right to walk over any of your neighbours'property — for example to put out your rubbish bin or to maintain your boundaries?	No
	If you have answered yes, please give details:	
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	No
	If you have answered yes, please give details:	
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)	No
	If you have answered yes, please give details:	
12.	Charges associated with the property	<u> </u>
a.	Is there a factor or property manager for your property?	No
	If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	
b.	Is there a common buildings insurance policy?	No
	If you have answered yes, is the cost of the insurance included in monthly/annual factor's charges?	
C.	Please give details of any other charges you have to pay on a regular bas upkeep of common areas or repair works, for example to a residents' ass or maintenance or stair fund.	

13.	Specialist work	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	Yes
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
	As recommended by the last home survey after purchase in 2018, treated for woodworm in loft and old garage space.	
b.	As far as you are aware, has any preventative work for dry rot,wet rot, or damp ever been carried out to your property?	No
	If you have answered yes, please give details:	
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	No
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.	
	Guarantees are held by:	
14.	Guarantees	1
а.	Are there any guarantees or warranties for any of the following?	
	(i) Electrical work	Don't know
	(ii) Roofing	No
	(iii) Central heating	Yes
	(iv) National House Building Council (NHBC)	No
	(v) Damp course	No
	(vi) Any other work installations? (for example, cavity wall installation, underpinning, indemnity policy)	No
b.	If you have answered 'yes' or 'with title deeds', please give details of the installations to which the guarantee(s) relate(s):	e work o
с.	Are there any outstanding claims under any of the guarantees listed above?If you have answered yes, please give details:	No

15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in thelast 10 years?	No
	If you have answered yes, please give details:	
16.	Notices that affect your property	
	In the past three years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	Yes
b.	that affects your property in some other way?	No
C.	that requires you to do any maintenance, repairs or improvements to your property?	No
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief

Name(s): Andrew Goodwin

Date: 01/11/2023



Residential

Home Report

Mortgage & Re-Mortgage Valuation Home & Flat Buyer Report Energy Performance Certificate (EPC) Private Sale Valuation Inheritance Tax Valuation Capital Gains Tax Valuation Separation Valuation **Driveby Valuation** Desktop Valuation New Build, Development & Plot Valuation Extension & Alteration Valuation Portfolio Valuation **Rental Valuation Expert Witness Report** Council Tax Appeal **Bespoke Condition Report**

Commercial

Commercial Valuation Commercial Agency Acquisitions & Disposals Commercial Lease Advisory Rent Reviews Asset Management Project Consultancy Development Appraisals Rating Commercial Property Auctions Property Management Professional Services Licensed Trade / Leisure

Glasgow West End

A 0141 353 2080

A 01475 730717

▲ 01698 897548

Inverness ▲ ▲ 01463 712239

A 01563 520318

Greenock

Hamilton

Kilmarnock

Property & Construction

Quantity Surveying Building Surveying Project Management Dispute Resolution Support Services Principal Designer Clerk of Works Commercial EPC Fire Engineering Health & Safety Management Employer's Agent Energy Department Housing Services Development Monitoring Mediation Services



 Dumfries

 ▲ 1387 264333

 Dundee

 ▲ 01382 200454

 ▲ 01382 20054

 ▲ 01382 720699

 Dunfermline

 ▲ 01383 722337

 ▲ 01383 731841

 ▲ 01355 248535

Edinburgh ▲ 0131 2251234 ▲ 0131 557 9300





Elgin ▲ 01343 553939

▲ 01324 635 999

Fraserburgh ▲ 01346 517456

A 01896 750150

▲ ▲ 0141 331 2807

Galashiels

Glasgow

Falkirk

Livingston ▲ 01506 416777 Montrose ▲ 01674 676768 Motherwell ▲ 01698 252229 Musselburgh ▲ 0131 653 3456 Oban ▲ 01631 707 800 Paisley ▲ 0141 889 8334 Perth ▲ 01738 638188 ▲ 01738 631631 Peterhead ▲ 01779 470766 St Andrews ▲ 01334 477773 ▲ 01334 477773 ▲ 01334 4774669 Saltcoats ▲ 01294 464228 Stirling ▲ 01786 450438 ▲ 01786 474476

www.shepherd.co.uk
 www.hardies.co.uk